



Siddhartha Spectro Pvt. Ltd.

(NABL Accredited, ISO-9001:2015 Approved Laboratory)

Address: Plot No.20, New Mandoli Industrial Area, Shahdara, Delhi-110093

CIN No: U74999DL2021PTC377846 ; Website: www.siddharthaspectro.in

E-mail: siddharthaspectro@gmail.com ; Ph. No.: 9560422870, 9717980908, 9873242909, 9810161092



TC-7270

SS/MSF/S.10.1

Test Report No : 231204136-02

ULR NO : TC727002300011081F

CUSTOMER DETAILS

STEEL KRAFTS

G.T ROAD, PANIPAT, HARYANA - 132103

PHONE : 0

EMAIL : --

SAMPLE DETAILS

| | |
|----------------------|------------|
| JOB REGISTRATION NO, | 2325692 |
| DATE OF RECEIPT | 04-12-2023 |
| DATE OF ISSUE | 10-12-2023 |

DESCRIPTION -

CABLE TRAY SAMPLE , 150x50x2mm Perforated Tray, Pre-Galvanised

Test Report

Page 01 of 01

Sample ID : 231204136
 Test Method : ASTM B 117:2019
 Test Duration : 96 hours
 Temperature : 35°C ± 2°C
 Start Date : 05-12-2023


Fog Collection : 1 to 2 ml/hr
 PH : 6.5 to 7.2
 NaCl Solution : 50 ± 10 grams / liter
 (min. assay 99.9%; ≤0.1% impurities)
 End Date : 09-12-2023

Observations-

Discipline: Chemical ; Group: Corrosion Tests

| S.No. | Time Interval | Observations |
|-------|----------------|---|
| 1. | After 24 hours | No signs of corrosion were observed on the surface of the sample. |
| 2. | After 48 hours | No signs of corrosion were observed on the surface of the sample. |
| 3. | After 72 hours | Slight red rust was observed only on some areas on the surface of the sample. |
| 4. | After 96 hours | Red rust was observed only on some areas on the surface of the sample. |

Photographic evidence after exposure period -

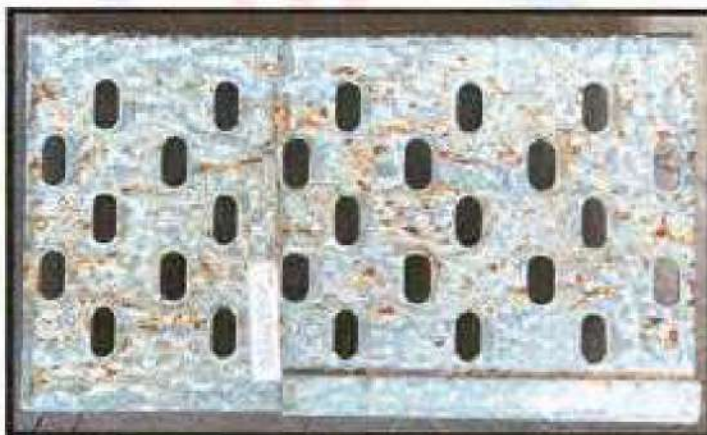

Note: Observation pertains only to the samples tested, not to its replicates or its batch.



Authorized Signatory

Terms & Conditions:

- The sample description is not verified in all cases and is given "As described by customers". Samples are not drawn by us.
- Total liability of our work is limited to the invoice amount and no liability will be accepted after the sample is returned.
- Sample will be disposed off after 30 days.
- The result listed refers only to the tested samples and applicable parameters.





Siddhartha Spectro Pvt. Ltd.

(NABL Accredited & ISO-9001:2015 Approved Laboratory)

Address: Plot No.20, New Mandoli Industrial Area, Shahdara, Delhi-110093

CIN No: U74999DL2021PTC377846 ; Website: www.siddharthaspectro.in

E-mail: siddharthaspectro@gmail.com ; Ph.No: 9560422870, 9717980908, 9873242909, 9810161092



SS/WSF/5.10.1

TEST REPORT NUMBER: 231204136-03

ULR NUMBER : TC727002300011086F

CUSTOMER DETAILS

STEEL KRAFTS
G.T. ROAD, PANIPAT, Panipat, Haryana, 132103

PHONE : 0
EMAIL : -

SAMPLE DETAILS

JOB REGISTRATION NO. 2325692
DATE OF RECEIPT 04-12-2023
DATE OF ISSUE 10-12-2023

DESCRIPTION-
CABLE TRAY SAMPLE , 150x50x2mm Perforated Tray, Pre Galvanised

Test Report

Sample ID : 231204136

Performance Date: 09-12-2023

Test Method: IS 6745-1972 : Mass of Zinc Coating
IS 2633-1986 : Uniformity of Zinc Coating
IS 2629-1985 : Adhesion of Zinc Coating

Discipline: Chemical Group: Metallic coatings & treatment solutions

| S.No. | Test Parameter | Observations |
|-------|---|-------------------------|
| 1 | Mass of Zinc Coating ; g/m ² | 95.409 g/m ² |
| 2 | Uniformity of Zinc Coating | Satisfactory |
| 3 | Adhesion of Zinc Coating | Satisfactory |

Note: The observations pertain only to the tested sample(s), not to its replicate or batch.

Tested by :

Authorized Signatory

Terms & Conditions:

1. The sample description is not verified in all cases and is given "As described by customers". Samples are not drawn by us.
2. Total liability of our work is limited to the invoice amount and no liability will be accepted after the sample is returned.
3. Sample will be disposed off after 30 days and any claim, thereafter, will not be valid.
4. The result listed refers only to the tested samples and applicable parameters, not to their replicate or batch.

